SERVICE BULLETIN

SERVICE BULLETIN NO: 30-004

REF NO: 071

30

MODIFICATION NO:

98 0172

ATA CHAPTER:

ICE AND RAIN PROTECTION - PROPELLER DE-ICING - INSTALLATION OF NEW TIMER UNIT AND BRUSH PACK

1. Planning Information

A. Effectivity

(1) All PC-12 and PC-12/45 aircraft from MSN 101 up to and including MSN 230.

This Service Bulletin will be incorporated prior to delivery on aircraft MSN 231 and subsequent.

(2) All Timer Units held as spares.

B. Concurrent Requirements

None.

C. Reason

(1) Problem

Some operators have reported incorrect indications of the propeller de-ice system.

(2) Cause

Investigations have found that due to intermittent contact of the Brush Pack, current drops are experienced.

(3) Solution

A new Brush Pack is installed in a better position and a new Timer Unit is introduced.

D. Description

This Service Bulletin introduces an improved Timer Unit and Brush Pack which will eliminate this problem. The electrical bonding of these items is also changed.

E. Compliance

Optional.

DATE: REV No. Sep 18/98

SERVICE BULLETIN No. 30-004 PAGE 1 of 9



F. Approval

FOR PLANNING PURPOSES

The technical aspects of this Service Bulletin have been approved by the Federal Office for Civil Aviation (FOCA) of Switzerland.

NOTE: PILATUS advises Operators/Owners to check with their local Airworthiness Authorities

for any changes, local regulations or sanctions that may affect the embodiment of this

Service Bulletin.

G. Manpower

TOTAL MAN-HOURS	5,0
Close up	1,5
Modification	2,0
Preparation	1,5
	Total

H. Weight and Balance

(1) Weight Change

Not affected.

(2) Moment Change

Not affected.

I. Electrical Load Data

Not changed.

J. Software

Not changed.

K. References

Aircraft Maintenance Manual (AMM), Chapters 30-60-00, 30-60-01 and 30-60-02.

L. Publications Affected

Aircraft Maintenance Manual (AMM), Chapters 30-60-00, 30-60-01 and 30-60-02.

Illustrated Parts Catalog (IPC), Chapter 30-60-00.

M. Interchangeability of Parts

Pre and Post SB Timer Units and Brush Packs are not interchangeable.

DATE: REV No. Sep 18/98

SERVICE BULLETIN No. 30-004

PAGE 2 of 9